

EN

INSTRUCTIONS
GAS DETECTOR



Table of contents

Notes regarding the instructions 2

Safety 2

Information about the device 4

Transport and storage 5

Operation 6

Maintenance and repair 8

Disposal 8

Notes regarding the instructions

Symbols

 **Warning of electrical voltage**
This symbol indicates dangers to the life and health of persons due to electrical voltage.

 **Danger**
This signal word indicates a hazard with a high risk level which, if not avoided, will result in serious injury or death.

 **Warning**
This signal word indicates a hazard with an average risk level which, if not avoided, can result in serious injury or death.

 **Caution**
This signal word indicates a hazard with a low risk level which, if not avoided, can result in minor or moderate injury.

Note
This signal word indicates important information (e.g. material damage), but does not indicate hazards.

 **Info**
Information marked with this symbol helps you to carry out your tasks quickly and safely.

 **Follow the manual**
Information marked with this symbol indicates that the instructions must be observed.

You can download the current version of the instructions and the EU declaration of conformity via the following link:



BG20



<https://hub.trotec.com/?id=40283>

Safety

Read this manual carefully before starting or using the device. Always store the manual in the immediate vicinity of the device or its site of use.

 **Warning**
Read all safety warnings and all instructions.
Failure to follow the warnings and instructions may result in electric shock, fire and/or serious injury.
Save all warnings and instructions for future reference.

- The device is supplied with a warning sign. Prior to initial start-up, make sure to paste the corresponding warning sign in your local language, if available, over the one present at the rear of the device as described in chapter Operation. Otherwise, choose a label in a language you know.



- Do not use the device in potentially explosive rooms or areas and do not install it there.
- Do not use the device in aggressive atmosphere.
- Do not immerse the device in water. Do not allow liquids to penetrate into the device.
- The device may only be used in dry surroundings and must not be used in the rain or at a relative humidity exceeding the operating conditions.
- Protect the device from permanent direct sunlight.
- Do not open the device.
- Do not remove any safety signs, stickers or labels from the device. Keep all safety signs, stickers and labels in legible condition.
- Never charge batteries that cannot be recharged.
- Different types of batteries and new and used batteries must not be used together.
- Insert the batteries into the battery compartment according to the correct polarity.

- Remove discharged batteries from the device. Batteries contain materials hazardous to the environment. Dispose of the batteries according to the national regulations.
- Remove the batteries from the device if you will not be using the device for a longer period of time.
- Never short-circuit the supply terminal in the battery compartment!
- Do not swallow batteries! If a battery is swallowed, it can cause severe internal burns within 2 hours! These burns can lead to death!
- If you think batteries might have been swallowed or otherwise entered the body, seek medical attention immediately!
- Keep new and used batteries and an open battery compartment away from children.
- Observe the storage and operating conditions (see Technical data).
- High concentrations of highly flammable gases can cause explosions, fire, suffocation and other hazards. Please obtain information on the gas you are working with and take the appropriate precautions.
- Calibrate the device in an environment that is free from gases affecting the measurement.

Intended use

Only use the device to measure the carbon monoxide concentration in the air. The measuring range is between 0 ppm and 1,000 ppm with an accuracy of $\pm 5\%$ or ± 10 ppm.

The device is only intended for private, non-commercial use in interior spaces.

To use the device for its intended use, only use accessories and spare parts which have been approved by Trotec.

Any use other than the intended use is regarded as misuse.

Reasonably foreseeable misuse

Do not use the device in hazardous areas or in any areas where an explosive gas/air mixture is likely to prevail.

The device is not intended for professional/commercial use.

Do not use the device as monitoring device for your personal safety. The device is no protective equipment.

Do not use the device for measurements in liquids and at live parts. Trotec accepts no liability for damages resulting from improper use. In such a case, any warranty claims will be voided. Any unauthorised modifications, alterations or structural changes to the device are forbidden.

Personnel qualifications

People who use this device must:

- be aware of the dangers that occur when working with carbon monoxide measuring devices.
- have read and understood the instructions, especially the Safety chapter.

Residual risks



Danger

Even low concentrations of carbon monoxide (CO) are life-threatening!

Carbon monoxide is toxic by inhalation! Make yourself familiar with the signs of CO poisoning and learn to recognize them.

Immediately remove persons who have inhaled carbon monoxide to fresh air. Immediately seek medical help!



Warning of electrical voltage

There is a risk of a short-circuit due to liquids penetrating the housing!

Do not immerse the device and the accessories in water. Make sure that no water or other liquids can enter the housing.



Warning of electrical voltage

Work on the electrical components must only be carried out by an authorised specialist company!



Warning of explosive substances

There is a danger of explosion due to sparking. Switch on the measuring device in an atmosphere that is free from combustible gas. The device calibrates itself automatically after switch-on. If combustible gases are already present in the environment, any further measuring results can be distorted and combustible gases may remain undetected.



Warning

High concentrations of combustible gases cause a risk of explosion, fire and suffocation.

Make yourself familiar with the safety data sheet regarding the characteristics of the gas to be detected and take the necessary precautions.



Warning

Risk of suffocation!

Do not leave the packaging lying around. Children may use it as a dangerous toy.



Warning

The device is not a toy and does not belong in the hands of children.

Warning
Dangers can occur at the device when it is used by untrained people in an unprofessional or improper way! Observe the personnel qualifications!

Caution
Keep a sufficient distance from heat sources.

Note
To prevent damages to the device, do not expose it to extreme temperatures, extreme humidity or moisture.

Note
Do not use abrasive cleaners or solvents to clean the device.

Examples for carbon monoxide concentration in the air

Examples for carbon monoxide concentrations and their effects:

0 to 1 ppm	Normal background levels
9 ppm	Max. permissible concentration for interior spaces
35 ppm	Max. average amount to which one may be exposed over a period of 8 hours. *
100 ppm	Exposure limit, persons ought to leave enclosed spaces. *
150 ppm	Slight headache after 1.5 hours
200 ppm	Mild headache, fatigue, nausea and dizziness
400 ppm	Frontal headache, life-threatening after 3 hours
800 ppm	Dizziness, nausea, convulsions, death within 2 to 3 hours
1600 ppm	Nausea within 20 minutes, death within 1 hour
3200 ppm	Headache, dizziness and nausea within 5 to 10 minutes. Death within 25 to 30 minutes.
12800 ppm	Death within 1 to 3 minutes
* according to OSHA = Occupational Safety & Health Association	

Information about the device


Device description

The carbon monoxide measuring device BG20 serves the purpose of measuring the concentration (ppm) of carbon monoxide (CO) in the air by means of an integrated sensor.

The device is designed for indoor use. The device is equipped with an automatic switch-off and memory function.


In order to protect it from impact, scratching etc., the device comes equipped with a protective cover.

Device depiction

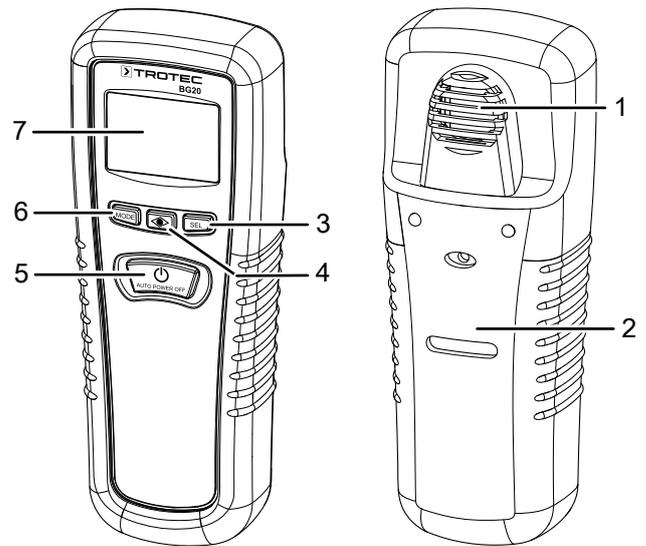

No.	Designation
1	Sensor
2	Protective cover
3	SEL button
4	Indicator LED
5	POWER button
6	MODE button
7	Display

Display

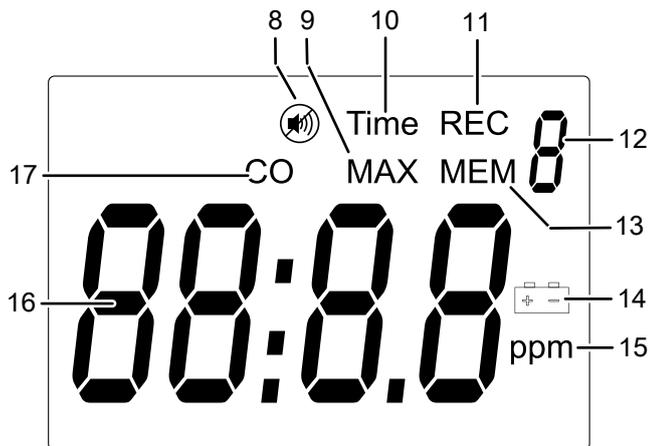

No.	Designation
8	MUTE indication
9	MAX indication
10	Time indication
11	REC indication
12	Memory space indication
13	MEM indication
14	Battery indication
15	Indication of the unit ppm
16	Measurement value indication
17	CO indication

Technical data

Parameter	Value
Model	BG20
Weight	180 g
Dimensions (length x width x height)	160 x 56 x 40 mm
Measuring range	0 ppm to 1000 ppm
Accuracy	±10 ppm or ±5 % (depending on which value is larger)
Measuring range resolution	1 ppm
Sensor type	Stabilised electrochemical gas-specific (CO)
Sensor life (typically)	5 years
Memory	For 10 measured values
Warm-up period	< 20 seconds
Power supply	1 x 9 V battery
Battery life	approx. 50 hours for an alkaline cell
Operating temperature	0 °C to 50 °C (32 °F to 122 °F)
Storage temperature	-30 °C to 60 °C (-22 °F to 140 °F)
Operating humidity	0 % RH to 99 % RH (non-condensing)

Scope of delivery

- 1 x Device BG20
- 1 x 9 V battery
- 1 x Bag/holster
- 1 x Quick guide

Transport and storage

Note

If you store or transport the device improperly, the device may be damaged.
Note the information regarding transport and storage of the device.

Transport

For transporting the device, use the bag included in the scope of delivery in order to protect the device from external influences.

Storage

When the device is not being used, observe the following storage conditions:

- dry and protected from frost and heat
- protected from dust and direct sunlight
- with a cover to protect it from invasive dust if necessary
- the storage temperature complies with the values specified in the Technical data
- Battery is removed from the device

Operation


Inserting the battery

- Insert the supplied battery before first use.


Note

Make sure that the surface of the device is dry and the device is switched off.

1. Remove the device from the protective rubber cover (2).
 ⇒ The protective rubber cover is fitted tightly. Push the protective cover above the display off the housing and remove it towards the rear.

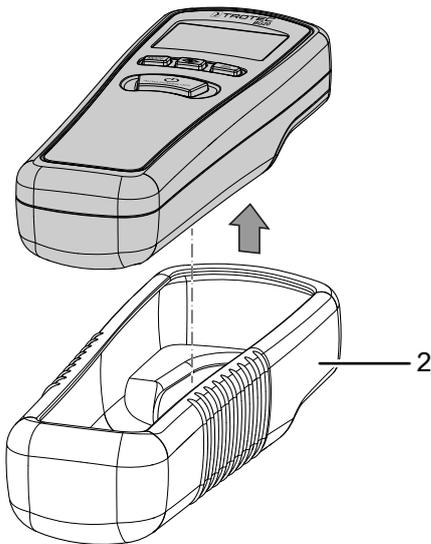

2. Loosen the screw at the cover of the battery compartment (18).

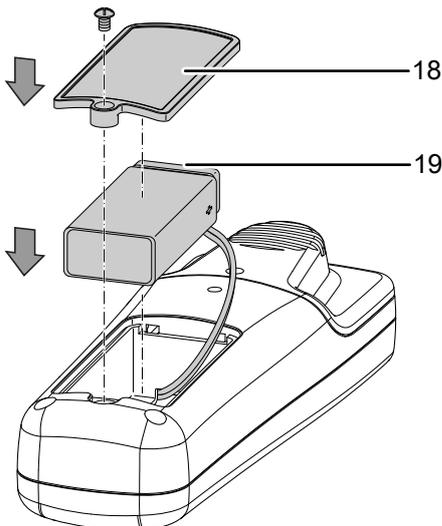


3. Use the battery clip (19) to connect the battery with correct polarity.
4. Screw the cover of the battery compartment (18) back in.
5. Pull the protective rubber cover back over the device.

Attaching the warning sign

Prior to initial start-up, check whether the warning sign at the rear of the device is in your local language, if not, paste the proper one over it. Otherwise, choose a label in a language you know. Please proceed as follows to attach the warning sign to the rear of the device:

1. Remove the desired label from the supplied film.
2. Affix the label in the intended position at the rear of the device.

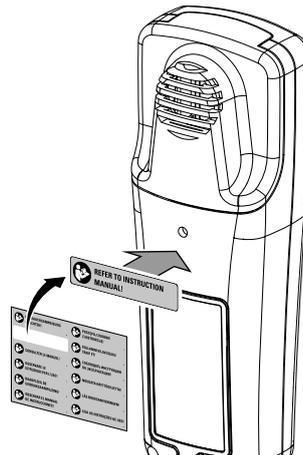

Moving to another site



Info

Please note that moving from a cold area to a warm area can lead to condensation forming on the device's circuit board. This physical and unavoidable effect can falsify the measurement. In this case, the display shows either no measured values or they are incorrect. Wait a few minutes until the device has become adjusted to the changed conditions before carrying out a measurement.

Switch-on

Note

The device calibrates after each switch-on taking the CO concentration in the environment as basis. For reasons of safety however, regardless of the actual CO concentration in the environment upon switch-on, the device accepts no more than 10 ppm as upper limit! Example: Should the background concentration of CO amount to 30 ppm, the device will not use 30 ppm as reference value, and hence zero point, but instead maximally 10 ppm! The set alarm threshold of 30 ppm (see also 'Carrying out a measurement') would therefore be activated at an actual CO value of 40 ppm (display: 30 ppm!).

Always make sure to switch the device on in CO-free surroundings, e.g. in fresh air, for otherwise the displayed CO contents of the subsequent measurements will be incorrect!

1. Go to a place with a low CO concentration (e.g. fresh air).
2. Press the *POWER* button (5).
 - ⇒ The indicator LED (4) will briefly flash red and then be illuminated in green. The warm-up phase of the device incl. self-test is started.
3. Wait until the self-test is completed.
 - ⇒ The device displays a countdown from 11 to 0 in the measurement value display (16).
 - ⇒ An acoustic signal indicates, that the self-test is completed.
 - ⇒ The device is ready for operation.

Carrying out a measurement

1. Direct the device towards the supposed CO source.
 - ⇒ The measured value is displayed in real time on the measurement value display (16).
 - ⇒ If the measured value amounts to more than 30 ppm, a repetitive acoustic warning signal will be emitted. The higher the CO content, the higher the repetition frequency. The LED (4) is illuminated in red.
 - ⇒ If the measured value amounts to more than 200 ppm, a constant acoustic warning signal will be emitted. The LED (4) is illuminated in red.

Displaying the maximum value

The device can display the maximum value determined since the beginning of the measurement. To do so, proceed as follows:

1. Press the *MODE* button (6) once.
 - ⇒ The indications *MAX* (9) and *REC* (11) appear on the display.
 - ⇒ The highest value measured appears in the measurement value display (16).

Measured value storage

The device comes equipped with a measured value memory, in which up to 10 measured values can be stored. Saved measured values are preserved even after switch-off. In order to save one or several measured values, please proceed as follows:

1. Press the *MODE* button (6) three times.
 - ⇒ The indications *REC* (11) and memory space (12) appear on the display.
 - ⇒ The value 0 or else the storage location displayed when last calling up the measured value memory will appear in the memory space (12) display.
2. Press the *SEL* button (3) to save the current measured value.



Info

The measured value memory is deleted when you perform a zero point reset (see *Resetting the zero point*).

Calling up the measured value memory

To call up saved measured values, please proceed as follows:

1. Press the *MODE* button (6) twice.
 - ⇒ The indications *MEM* (13) and memory space (12) appear on the display.
2. Repeatedly press the *SEL* button (3) until the storage location with the desired number is displayed.

Calling up the alarm threshold

The value for the alarm threshold is stipulated, can however be called up at any time:

1. Press the *MODE* button (6) four times.
 - ⇒ The value 30 ppm is displayed in the measurement value display (16).

Resetting the zero point

Note

Resetting the zero point should only be effected in the fresh air, thus in surroundings with the lowest possible CO concentration!

By means of resetting the zero point the prevailing CO concentration and hence the current measured value is defined as new reference value (see also *Switch-on*). To do so, proceed as follows:

1. Go to a place with a low CO concentration (e.g. fresh air).
2. Press the *MODE* button (6) four times.
 - ⇒ The alarm threshold (30 ppm) is displayed in the measurement value display (16).
3. Press and hold the *SEL* button (3) for approx. 8 seconds until 0 appears in the measurement value display.
 - ⇒ The digit 0 flashes six times.
 - ⇒ Then the device returns to the measuring mode.
 - ⇒ The saved measured values will be deleted.

Show measuring time

The device saves the measuring time after switch-on. Please proceed as follows to retrieve the measurement time:

1. Press the *MODE* button (6) five times.
 - ⇒ The *Time* indication (10) appears on the display.
 - ⇒ The measuring time is indicated in the measured value display (16) in the format hours:minutes.

Disabling the acoustic warning signal

1. Press the *MODE* button (6) six times until either on or off is displayed.
2. Press the *SEL* button (3) to select the desired setting.
 - ⇒ When *on*, the acoustic warning signal is enabled.
 - ⇒ When *off*, the acoustic warning signal is disabled. The *MUTE* indication (8) appears on the display.

Switching the display illumination on or off

Ex works the display illumination is switched off.

1. Press the *SEL* button (3) for approx. 2 seconds, whilst the device is in normal measuring mode.
 - ⇒ The display's background illumination is switched on or off.

Switch-off

The device comes equipped with an automatic switch-off function and switches off automatically after 15 minutes of inactivity.

To switch off the device manually, press the *POWER* button (5).

Maintenance and repair

Battery change

A battery change is required if the Battery indication (14) lights up on the display (7), if the indications on the display (7) flicker or are only faintly visible or if the device can no longer be switched on. See chapter Operation.

Sensor

The sensor life amounts to approx. 5 years. During this time, we recommend checking/calibrating the sensor annually.

Cleaning

Clean the device with a soft, damp and lint-free cloth. Make sure that no moisture enters the housing. Do not use any sprays, solvents, alcohol-based cleaning agents or abrasive cleaners, but only clean water to moisten the cloth.

Repair

Do not modify the device or install any spare parts. For repairs or device testing, contact the manufacturer.

Disposal

Always dispose of packing materials in an environmentally friendly manner and in accordance with the applicable local disposal regulations.



The icon with the crossed-out waste bin on waste electrical or electronic equipment is taken from Directive 2012/19/EU. It states that this device must not be disposed of with the household waste at the end of its life. You will find collection points for free return of waste electrical and electronic equipment in your vicinity. The addresses can be obtained from your municipality or local administration. You can also find out about other return options that apply for many EU countries on the website <https://hub.trotec.com/?id=45090>. Otherwise, please contact an official recycling centre for electronic and electrical equipment authorised for your country.

The separate collection of waste electrical and electronic equipment aims to enable the re-use, recycling and other forms of recovery of waste equipment as well as to prevent negative effects for the environment and human health caused by the disposal of hazardous substances potentially contained in the equipment.



In the European Union, batteries and accumulators must not be treated as domestic waste, but must be disposed of professionally in accordance with Directive 2006/66/EC of the European Parliament and of the Council of 6 September 2006 on batteries and accumulators. Please dispose of batteries and accumulators according to the relevant legal requirements.

Only for United Kingdom

According to Waste Electrical and Electronic Equipment Regulations 2013 (SI 2013/3113) (as amended) and the Waste Batteries and Accumulators Regulations 2009 (SI 2009/890) (as amended), devices that are no longer usable must be collected separately and disposed of in an environmentally friendly manner.

Trotec GmbH

Grebbeener Str. 7
D-52525 Heinsberg

☎ +49 2452 962-400

☎ +49 2452 962-200

✉ info@trotec.com

www.trotec.com